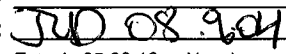


Date: Thursday, 04/09/2008 1:24:03 PM
User: Julie Lecocq

Process Sheet

Customer :	CU-DAR001 Dart Helicopters Services	Drawing Name :	FWD TUBE ASSEMBLY
Job Number :	41835		
Estimate Number :	10467		
P.O. Number :		Part Number :	D3391021
This Issue :	04/09/2008	S.O. No. :	
Prsht Rev. :	NC	Drawing Number :	D3391 REV G
First Issue :	/ /	Project Number :	N/A
Previous Run :	41834	Drawing Revision :	G
	Type :	Material :	
	SKIDTUBES	Due Date :	25/09/2008
Written By :		Qty:	1 Um: Each
Checked & Approved By :			
Comment :	Est. A 05.09.13 New issue KJ/JLM Est. B 06.02.10 Dwg rev.D ecn 773 EC Est. C 06.05.02 Added inspections EC est D 07.03.13 rev F dwg EC est E 07.11.07 revG dwg ecn1053P EC verified by: DD Est Rev:f ECN 1056 07-11-12 DD verified by: EC		

Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
----------------	------------------------------	----------------------

1.0	D6013047	Skidtube Material
-----	----------	-------------------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)
SKIDTUBE MAT'L

Pick:

Qty	Part Number	Description	Batch
1	D6013-047	Extrusion	<u>26547</u>

8T 08-09-05

2.0	SKIDTUBES 1	SKIDTUBESS RESOURCE 1
-----	-------------	-----------------------



Comment: LANDING GEAR RESOURCE 1
Cut extrusion to 46.52 +0.010 -0.020

8T 08-09-05

3.0	BENDING	BENDING MACHINE - SKIDTUBES
-----	---------	-----------------------------



Comment: Nc bender
Bend as per Dwg D3391 Using Bend Prog 3391021

8T 08-09-05

4.0	QC5	INSPECT WORK TO CURRENT STEP
-----	-----	------------------------------



Comment: INSPECT WORK TO CURRENT STEP

8 08/09/05 (60)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 04/09/2008 1:24:03 PM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FWD TUBE ASSEMBLY

Job Number: 41835

Part Number: D3391021

Job Number:



Seq. #:

Machine Or Operation:

Description :

5.0

HAAS1

HAAS CNC VERTICAL MACHINING #1



Comment: HAAS CNC VERTICAL MACHINING #1

1-Machine as per Folio FA590 Rev. F & Dwg D3391 Rev. G

Identify as D3391-1

2-Deburr

J.L 08/09/07

6.0

QC2

INSPECT PARTS AS THEY COME OFF MACHINE



Comment: INSPECT PARTS AS THEY COME OFF MACHINE

J.L 08/09/07

7.0

MILLING CONV.

CONVENTIONAL MILLING MACHINE



Comment: CONVENTIONAL MILLING MACHINE

Drill X1 Aft cap as per Dwg D3391 .1875" dia

mmp 08/09/11

8.0

QC2

INSPECT PARTS AS THEY COME OFF MACHINE



Comment: INSPECT PARTS AS THEY COME OFF MACHINE

mmp 08/09/11

9.0

QC8

SECOND CHECK



Comment: SECOND CHECK

J.L 08-9-11

10.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Drill float bag holes as per Dwg D3391 using DT8798(Do not open tow cap holes to finish size)
(ONLY DRILL HOLES MARKED "A")

2-Drill Remaining two holes for tow cap using DT 8819 Locating off of .1875" holes drilled in previous step

3-Open tow cap holes to .208" as per Dwg D3391

4-Open Tow Ring hole to .640" as per Dwg D3391

5-Deburr & Scribe Batch number Inside aft end.

6-Transfer drill D3391-021 with D3391-023

M 8-10-12

H
8-9-13

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 04/09/2008 1:24:03 PM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FWD TUBE ASSEMBLY

Job Number: 41835

Part Number: D3391021

Job Number:



Seq. #:

Machine Or Operation:

Description :

11.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

508/10/22 @

12.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



AWM 8-10-23



Comment: HAND FINISHING RESOURCE #1

Acid etch and Alodine as per QSI 005 4.1

13.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

D M 8-10-23

14.0

D36704200

SPACER



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

SPACER

batch: 41615

SL 8-10-24

15.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-instal spacers as per dwg D3391

A/R Magnabond 6398 batch: 108966

exp. date: 9-10-1

cure time 12hrs. as per QSI015

2- grind crossbolt flush

3-back drill crossbolt if necessary

SL 8-10-24

SL 8-10-26

16.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

508/10/22 @

17.0

POWDER COATING

POWDER COATING



M 109152



(1X)

Comment: POWDER COATING

Powder Coat White Gloss (Ref: 4.3.5.1) as per QSI 005 4.3

START TIME: 11:00

OVEN TEMPERATURE: 320°F

M-A 08/11/20

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 04/09/2008 1:24:03 PM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FWD TUBE ASSEMBLY

Job Number: 41835

Part Number: D3391021

Job Number:



Seq. #:

Machine Or Operation:

Description :

FINISH TIME:

11-30

M-# 08/11/20

18.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



JS



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

08-11-21

(X)

19.0

ALS41032130

Insert



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

INSERT

batch: M105819

or equivalent

per QSI 017

JS

20.0

ALS41032225

Insert



Comment: Qty.: 10.0000 Each(s)/Unit Total : 10.0000 Each(s)

INSERT

batch: M100621

or equivalent

per QSI 017

JS

21.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Install Inserts as per Dwg

JS

08-11-21

(X)

22.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

S 08/11/21 (X)

23.0

D3401041

Tow Cap Assembly



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Tow Cap Assembly

Pick:

Qty

Part Number

Description

Batch

1

D3401-041

Tow Cap

B36216:

JS

08-11-24

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 04/09/2008 1:24:03 PM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FWD TUBE ASSEMBLY

Job Number: 41835

Part Number: D3391021

Job Number:



Seq. #:

Machine Or Operation:

Description :

24.0

D356413

Wearshoe



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

1341933

9/1

25.0

D356613

Gasket



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

GASKET

1341862

9/1

26.0

D36721

Phenolic Washer



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

PHENOLIC WASHER

1339275

9/1

27.0

AN3C4A

BOLT



Comment: Qty.: 10.0000 Each(s)/Unit Total : 10.0000 Each(s)

Bolt

Pick:

Qty

Part Number

Description

Batch

4

AN3C4A

Bolt

11109431

9/1

28.0

AN960C10L

washer



Comment: Qty.: 10.0000 Each(s)/Unit Total : 10.0000 Each(s)

washer

11109798

9/1

29.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: SMALL & MEDIUM FAB RESOURCE 1

Install tow Cap as per Dwg D3391

Identify as D3391-021

9/1

08-11-24 20

30.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

Inspect thread of each insert using DT8821

S. Schulz 24 40

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 04/09/2008 1:24:03 PM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FWD TUBE ASSEMBLY

Job Number: 41835

Part Number: D3391021

Job Number:



Seq. #:

Machine Or Operation:

Description :

31.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and Stock

Location: PPR 41685 8/11/25 (1)

32.0

QC21

FINAL INSPECTION/W/O RELEASE



08/11/26 JF

Comment: FINAL INSPECTION/W/O RELEASE

Job Completion



MF 08-11-26


W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

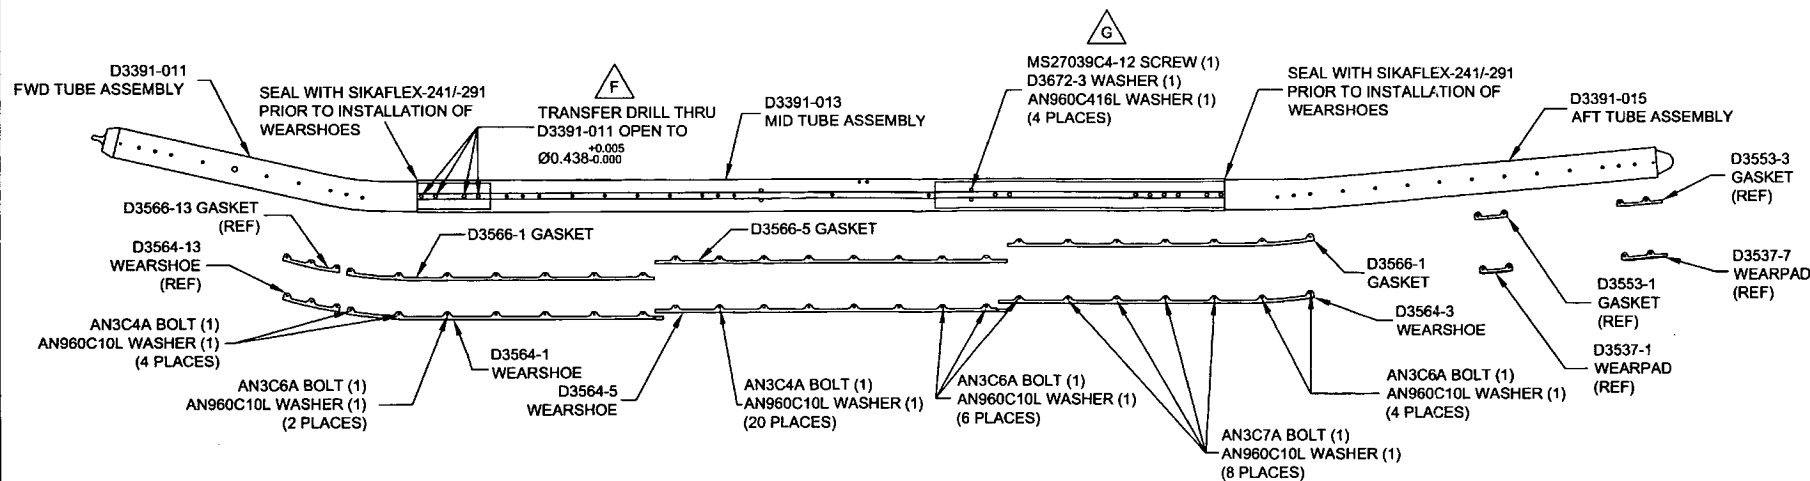

D3391-041 ASSEMBLY

RELEASED
27-11-87

D3391-041 FLOAT SKIDTUBE ASSEMBLY PARTS LIST

QTY	PART NUMBER	DESCRIPTION
1	D3391-041	FLOAT SKIDTUBE ASSEMBLY
1	D3391-011	FWD TUBE ASSEMBLY
1	D3391-013	MID TUBE ASSEMBLY
1	D3391-015	AFT TUBE ASSEMBLY
1	D3564-1	WEARSHOE
1	D3564-3	WEARSHOE
1	D3564-5	WEARSHOE
2	D3566-1	GASKET
1	D3566-5	GASKET
4	D3672-3	WASHER
24	AN3C4A	BOLT
12	AN3C6A	BOLT
6	AN3C7A	BOLT
4	AN960C10L	WASHER
1	MS27039C4-12	SCREW
1	AN960C416L	WASHER

GENERAL NOTES

- 1) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
- 2) SPRAY INSIDE OF TUBE WITH A COAT OF LPS LABORATORIES "LPS-3" AFTER FINISH
AND AFTER INSTALLATION OF INSERTS. COAT ALL EXPOSED FASTENERS WITH
LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY, CLEAN EXCESS
OFF POWDER COATING WITH MEK DEGREASER.
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL Ø0.297 SIZE HOLES
FOR WEARSHOE INSERTS. C'BORE AS NOTED AND INSTALL INSERTS EXCEPT
WHERE INDICATED.


G	REPLACE NAS INSERTS W/ AELS INSERTS SWITCH TO D3670-XXXX SPACERS FOR INSTALLING FLOAT BAGS, DWG REORGANIZED FOR CLARITY	DC	07.07.31
F	ADD SS WEARSHOE, GASKET REMOVE FWD SADDLE HOLE -011/-021	PH	07.01.18
E	CHANGE TOLERANCE, EASE MANUFACTURE	PH	06.04.25
D	UPDATE TOLERANCE, CHANGE HOLE SIZE	PH	06.01.23
C	LENGTHEN AFT EXTENSION	PH	05.09.27
B	DRAWING UPDATES	PH	05.06.10
A	NEW ISSUE	PH	05.02.07
REV.	DESCRIPTION	BY	DATE
DESIGN			
DRAWN			
CHECKED			
MFG. APPR.			
APPROVED			
DE APPR.			
DATE	07.07.31		

DART AEROSPACE USA, INC
PORT HADLOCK, WA

DRAWING NO. D3391 REV. G
SHEET 1 OF 8
TITLE 412 FLOAT SKIDTUBE
SCALE NTS

COPYRIGHT © 2005 BY DART AEROSPACE USA, INC
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS
NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT
WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

NO. 47835
WITHOUT NOTICE
SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT

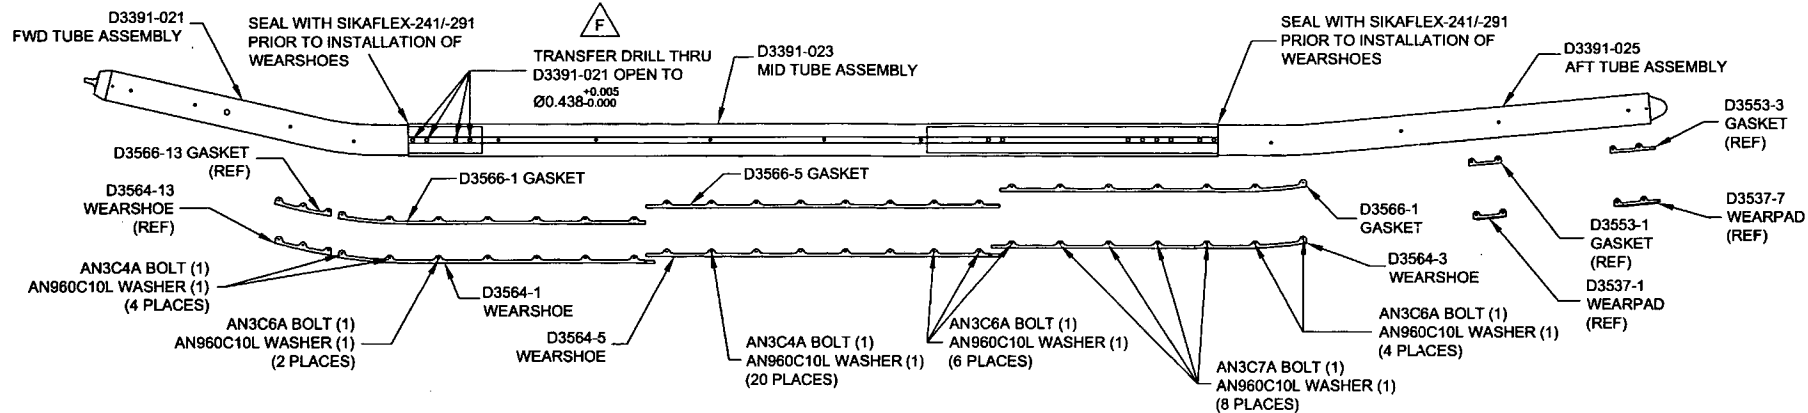

D3391-043 ASSEMBLY

RELEASED
07.11.84

D3391-043 FLOAT SKIDTUBE ASSEMBLY PARTS LIST

QTY	PART NUMBER	DESCRIPTION
X	D3391-043	FLOAT SKIDTUBE ASSEMBLY
1	D3391-021	FWD TUBE ASSEMBLY
1	D3391-023	MID TUBE ASSEMBLY
1	D3391-025	AFT TUBE ASSEMBLY
1	D3564-1	WEARSHOE
1	D3564-3	WEARSHOE
1	D3564-5	WEARSHOE
2	D3566-1	GASKET
1	D3566-5	GASKET
24	AN3C4A	BOLT
12	AN3C6A	BOLT
6	AN3C7A	BOLT
44	AN960C10L	WASHER


GENERAL NOTES

- 1) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
- 2) SPRAY INSIDE OF TUBE WITH A COAT OF LPS LABORATORIES "LPS-3" AFTER FINISH AND AFTER INSTALLATION OF INSERTS. COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY, CLEAN EXCESS OFF POWDER COATING WITH MEK DEGREASER.
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL Ø0.297 SIZE HOLES FOR WEARSHOE INSERTS. C'BORE AS NOTED AND INSTALL INSERTS EXCEPT WHERE INDICATED.


DESIGN	PH	DART AEROSPACE USA, INC
DRAWN	JLC	PORT HADLOCK, WA
CHECKED	B	DRAWING NO. D3391
MFG. APPR.	JP	REV. G
APPROVED	PH	SHEET 2 OF 8
DE APPR.	PH	TITLE 412 FLOAT SKIDTUBE
DATE	07.07.31	SCALE NTS

COPYRIGHT © 2005 BY DART AEROSPACE USA, INC.
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.


SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
NO. 4835

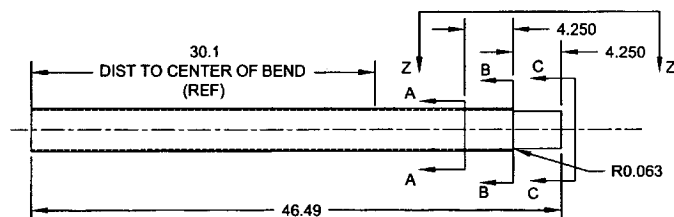


D3391-1 CUTTING DETAIL
(MAKE FROM D6013-047 SKIDTUBE MATERIAL)

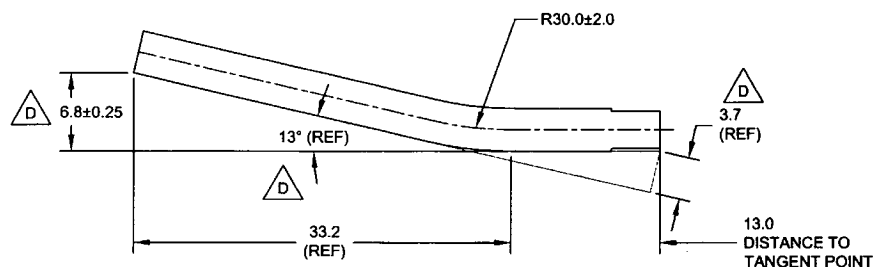


D3391-011/-021 BENDING DETAIL
(MAKE FROM D3391-1)

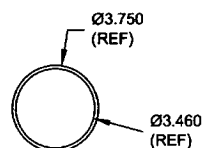


SECTION A-A
(SCALE 1:5)

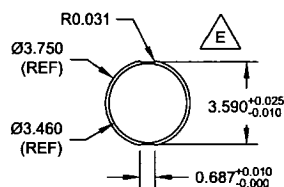

SECTION B-B
(SCALE 1:5)

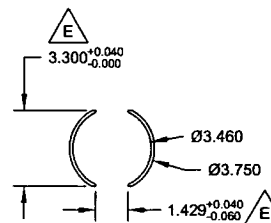

SECTION C-C
(SCALE 1:5)

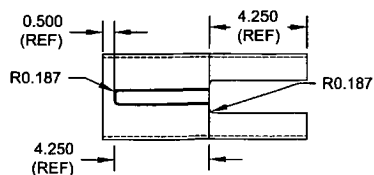


VIEW Z-Z
(SCALE 1:5)


RELEASED
07-11-06

NO. 412-33
WORK ORDER
SUBJECT TO AMENDMENT
UNCONTROLLED COPY
ENGINEERING
RETURN TO
SHOP COPY
WITHOUT NOTICE


DESIGN		DART AEROSPACE USA, INC	
DRAWN		PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. G
MFG. APPR.		D3391	SHEET 3 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	1:10
DATE	07.07.31	<small>COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIES OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small>	

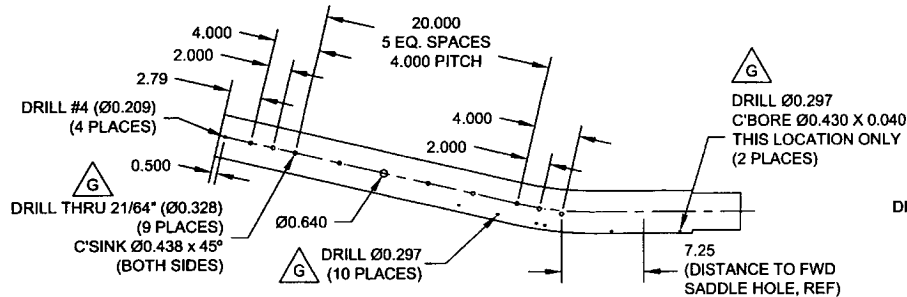


D3391-011 DRILLING DETAIL

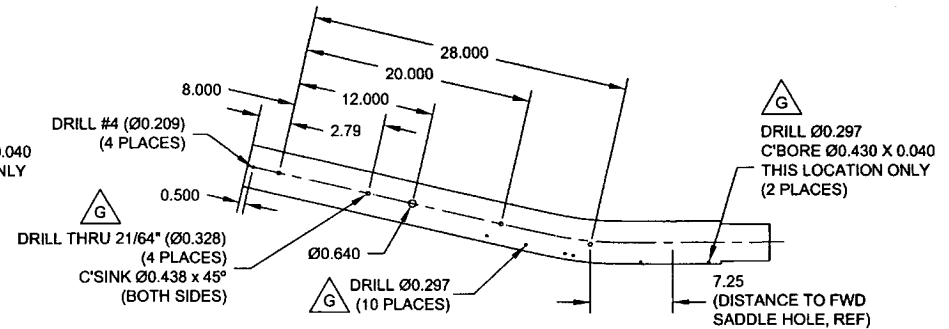

D3391-021 DRILLING DETAIL

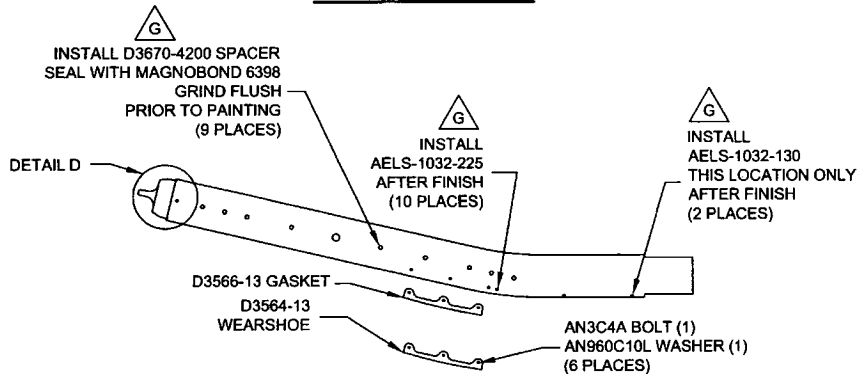

D3391-011 ASSEMBLY DETAIL

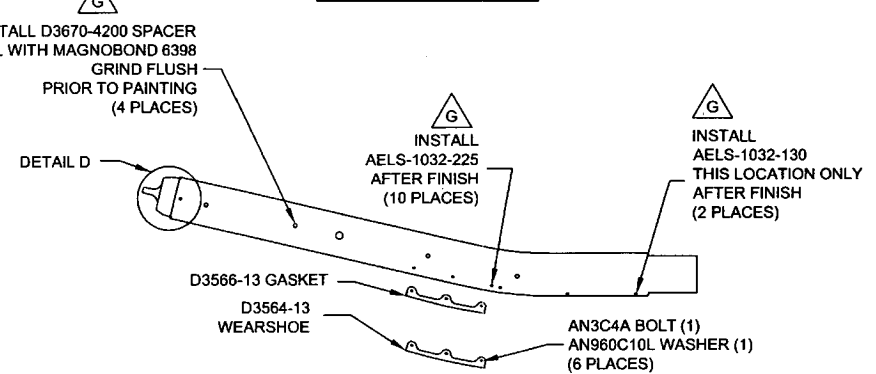


D3391-021 ASSEMBLY DETAIL

RELEASED
07-11-06

D3391-011/-021 FWD TUBE ASSEMBLY PARTS LIST

QTY - 011	QTY - 021	PART NUMBER	DESCRIPTION
X		D3391-011	FWD TUBE ASSEMBLY
	X	D3391-021	FWD TUBE ASSEMBLY
1	1	D6013-047	FWD TUBE
1	1	D3401-041	TOW CAP
1	1	D3564-13	WEARSHOE
1	1	D3566-13	GASKET
9	4	D3670-4200	SPACER
4	4	D3672-1	WASHER
10	10	AN3C4A	BOLT
10	10	AN960C10L	WASHER
2	2	AELS-1032-130	INSERT
10	10	AELS-1032-225	INSERT

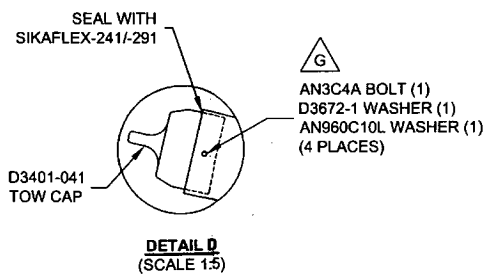

DESIGN		DART AEROSPACE USA, INC
DRAWN		PORT HADLOCK, WA
CHECKED		DRAWING NO. REV. G
MFG. APPR.		D3391 SHEET 4 OF 8
APPROVED		TITLE SCALE
DE APPR.		412 FLOAT SKIDTUBE 1:10
DATE	07.07.31	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC


NO. 41835
WORK ORDER
SUBJECT TO AMENDMENT
WITHOUT NOTICE
ENGINEERING
RETURN TO
SHOP COPY

D3391-013 MID TUBE ASSEMBLY
 MATERIAL: MAKE FROM D2500-1-100 EXTRUSION
 INSTALL D3391-1 WEB TO OUTER TUBE USING SIKAFLEX-241/291 PER OSI 015
 WELDING: PER DART OSI 004


QTY	PART NUMBER	DESCRIPTION
X	D3391-013	MID TUBE ASSEMBLY
1	D2500-1-100	EXTRUSION
12	D3389-1	SPACER
4	D3672-1	WASHER
4	D3672-3	WASHER
24	AEI S-1032-130	INSERT
4	AL54-428-165	INSERT
4	AN980C10L	WASHER
4	AN980C416L	WASHER
4	MS27039C1-09	SCREW
4	MS27039C4-08	SCREW

D3391-013 MID TUBE ASSEMBLY PARTS LIST


SECTION G-G
 (SCALE 1:4)

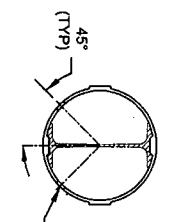





SECTION H-H
 (SCALE 1:4)

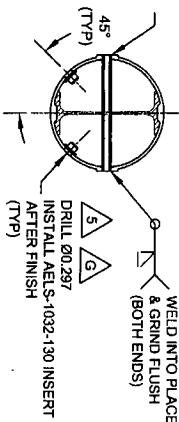


SECTION X-X
 (SCALE 1:4)

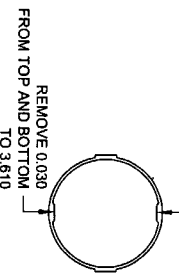


SECTION Y-Y
 (SCALE 1:4)

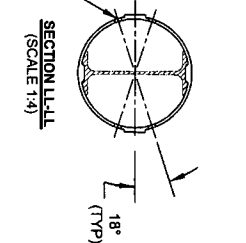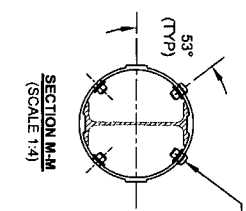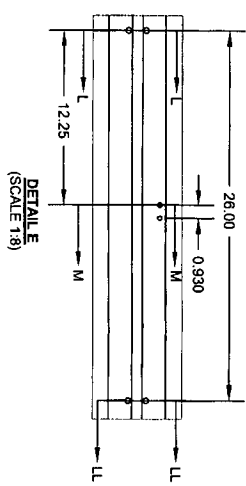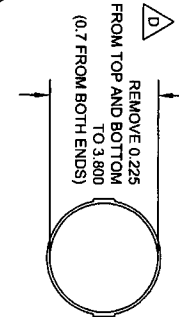


DETAIL J
 (SCALE 1:5)

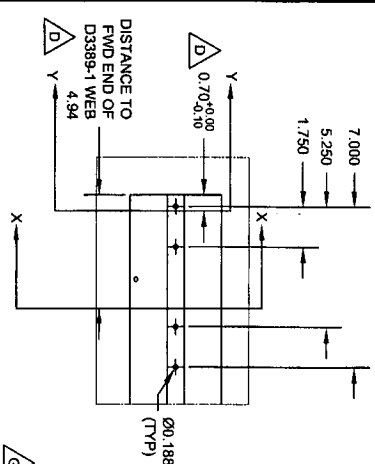

D3391-013 ASSEMBLY DETAIL

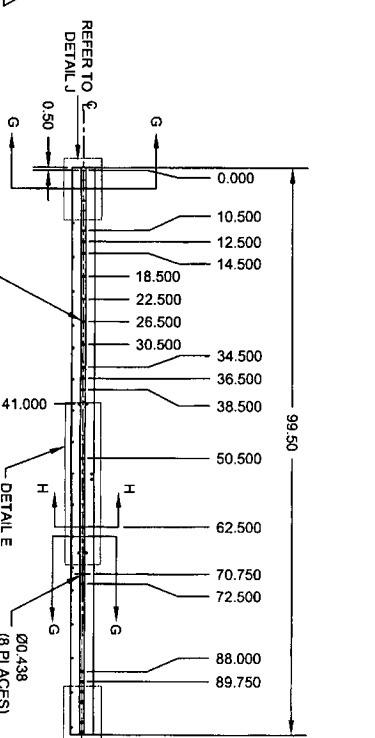

DETAIL K
 (SCALE 1:5)





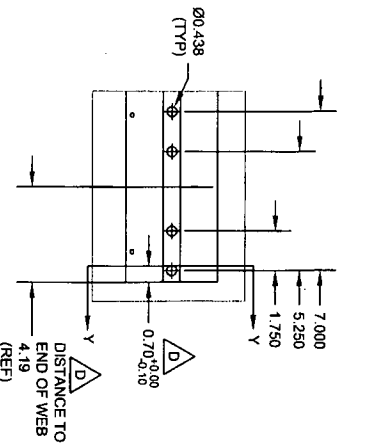


RELEASED
 07.11.2017

DESIGN	#	DART AEROSPACE USA, INC
DRAWN	OP	PORT HADLOCK, WA
CHECKED		
MG, APPR		
APPROVED		
DE APPR		
DATE	07.07.31	
TITLE	412 FLOAT SKIDTUBE	
SCALE	1:20	

COPYRIGHT © 2017 DART AEROSPACE USA, INC
 ALL RIGHTS RESERVED. NO PART OF THIS DOCUMENT MAY BE REPRODUCED OR TRANSMITTED IN ANY FORM OR BY ANY MEANS WITHOUT PERMISSION FROM DART AEROSPACE USA, INC.

8 7 6 5 4 3 2 1

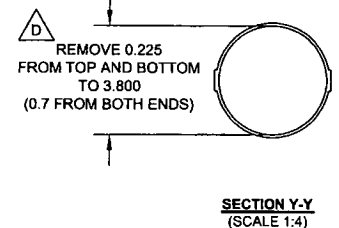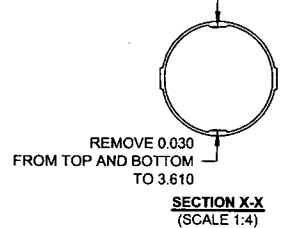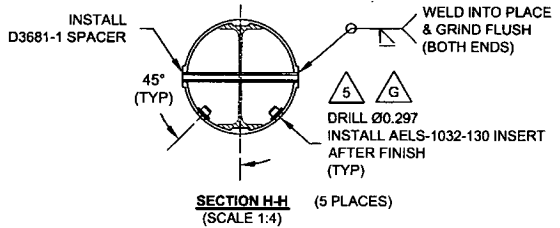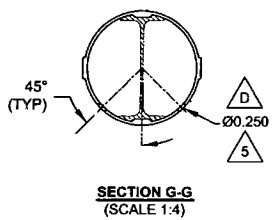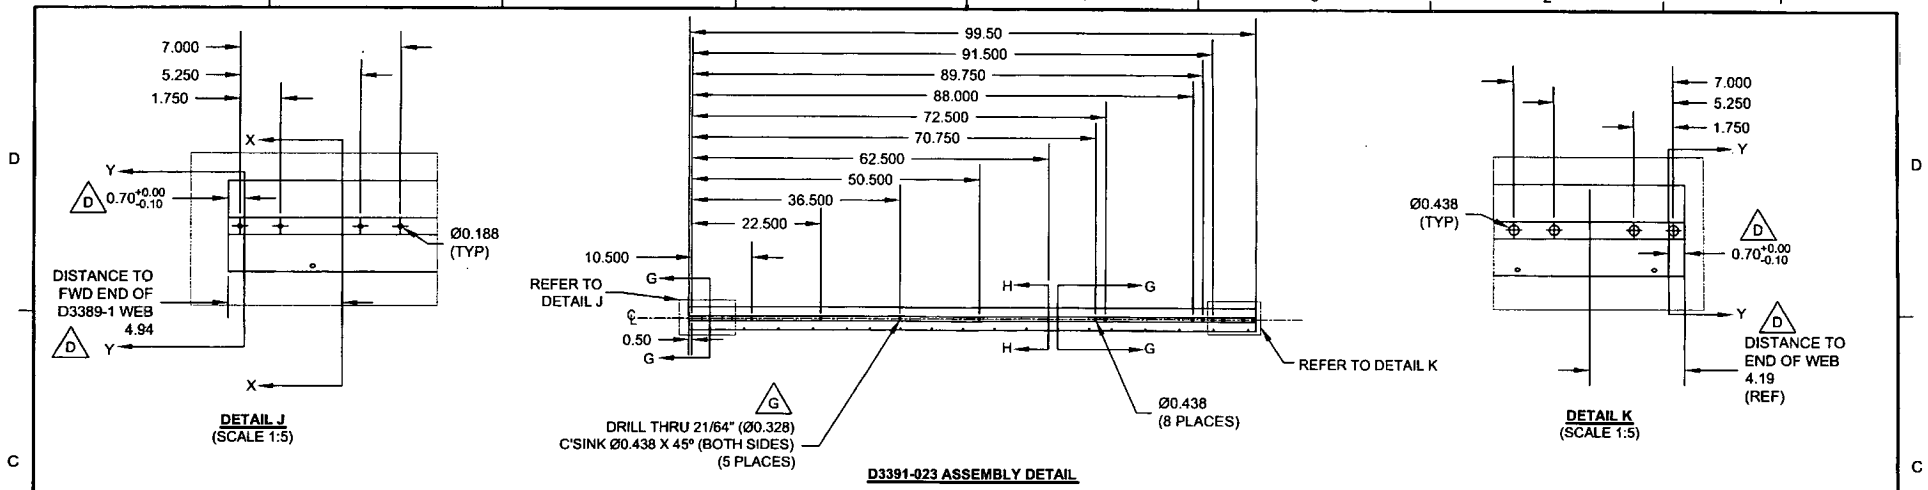

D3391-023 MID TUBE ASSEMBLY PARTS LIST

QTY - 023	PART NUMBER	DESCRIPTION
X	D3391-023	MID TUBE ASSEMBLY
1	D2500-1-100	EXTRUSION
1	D3389-1	WEB
5	D3681-1	SPACER
20	AELS-1032-130	INSERT

RELEASED
67.11.06/11


DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	DE	PORT HADLOCK, WA	
CHECKED	DE	DRAWING NO.	REV. G
MFG. APPR.	DE	D3391	SHEET 6 OF 8
APPROVED	DE	TITLE	SCALE
DE APPR.	DE	412 FLOAT SKIDTUBE	1:20
DATE	07.07.31	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC	

NO. 4835
WORK ORDER
SUBJECT TO AMENDMENT
WITHOUT NOTICE
UNCONTROLLED COPY
RETURN TO
ENGINEERING
FOR COPY

D3391-023 MID TUBE ASSEMBLY
MATERIAL: MAKE FROM D2500-1-100 EXTRUSION
INSTALL D3389-1 WEB TO OUTER TUBE USING SIKAFLEX-241/291 PER QSI 015
WELDING PER DART QSI 004

7 6 5 4 3 2 1



8 7 6 5 4 3 2 1

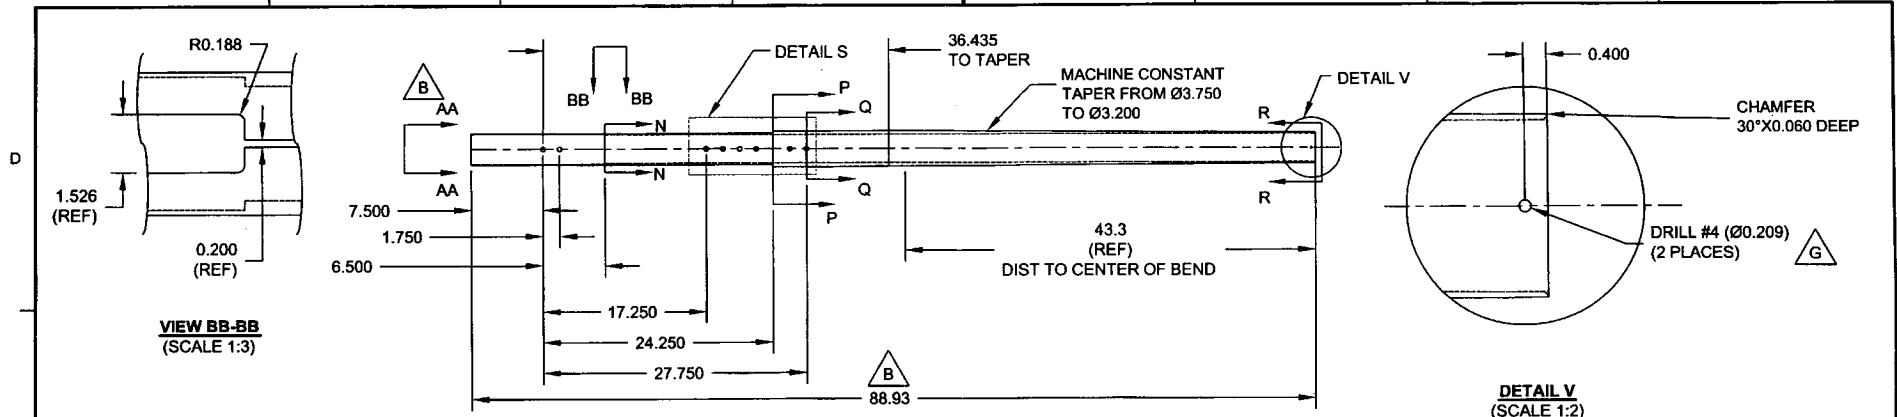

VIEW BB-BB
(SCALE 1:3)

D3391-3 AFT DRILLING AND CUTTING DETAIL
(MAKE FROM D6014-090 SKIDTUBE MATERIAL)

DETAIL V
(SCALE 1:2)

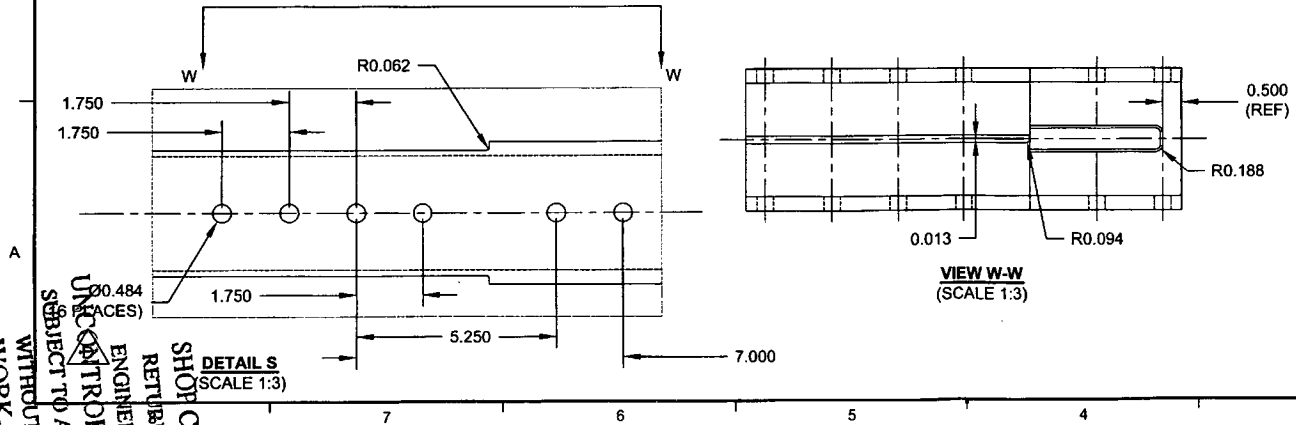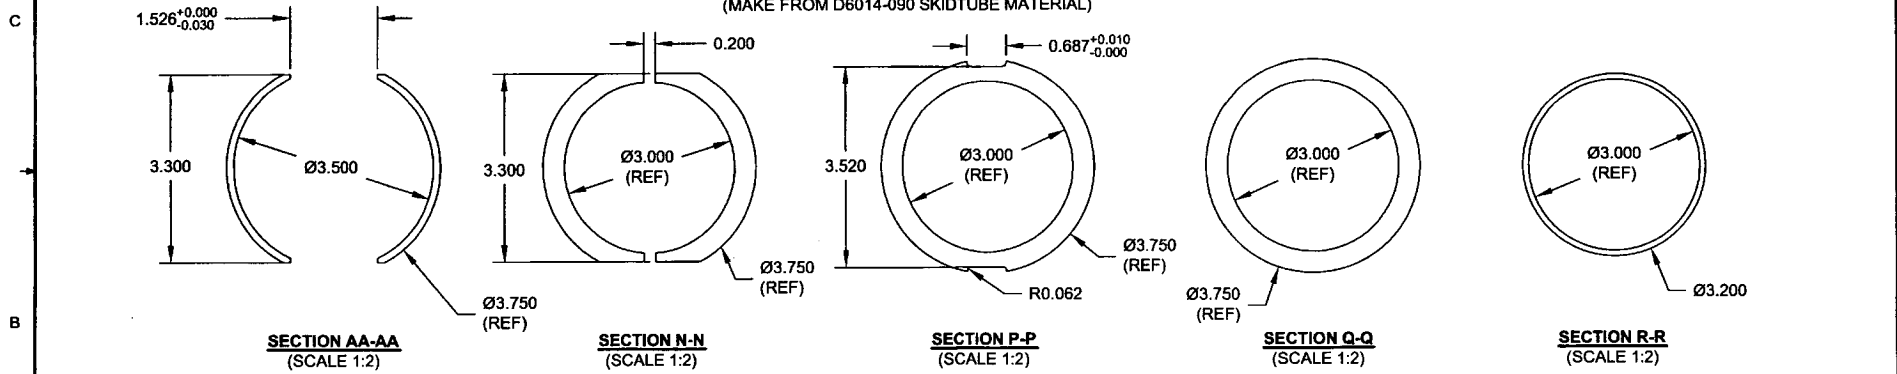

VIEW W-W
(SCALE 1:3)


DETAIL S
(SCALE 1:3)

RELEASED
07-11-06

DESIGN		DART AEROSPACE USA, INC
DRAWN		PORT HADLOCK, WA
CHECKED		DRAWING NO. D3391
MFG. APPR.		REV. G SHEET 7 OF 8
APPROVED		TITLE 412 FLOAT SKIDTUBE
DE APPR.		SCALE 1:12
DATE	07.07.31	

COPYRIGHT © 2005 BY DART AEROSPACE USA, INC
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

NO. 97835
 WORK ORDER
 WITHOUT NOTICE
 SUBJECT TO AMENDMENT
 UNCONTROLLED COPY
 ENGINEERING
 RETURN TO
 SHOP COPY
 00.484 (2 PLACES)

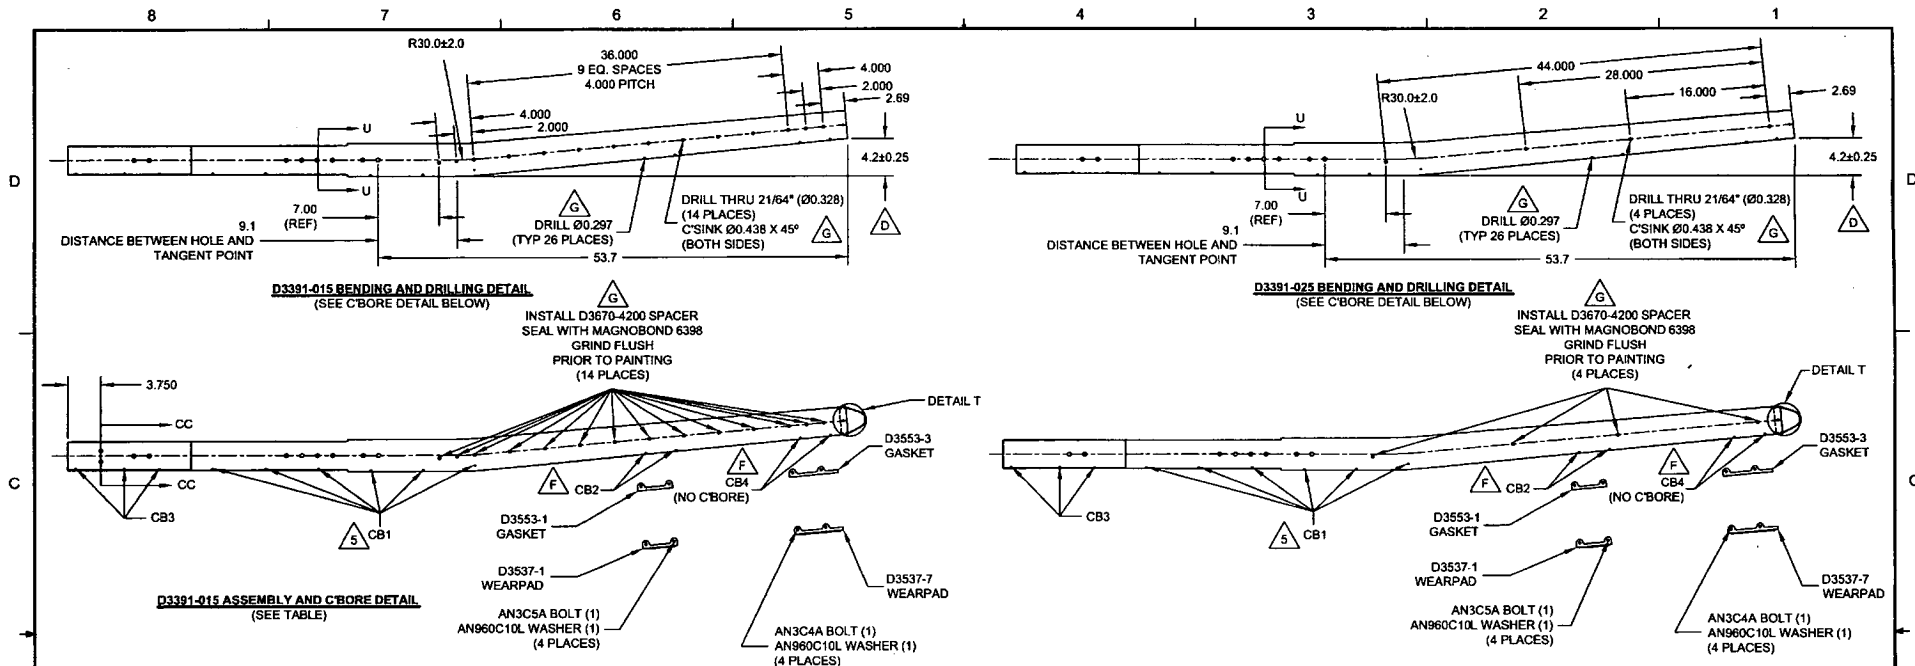


D3391-015/025 AFT TUBE ASSEMBLY PARTS LIST


QTY - 015	QTY - 025	PART NUMBER	DESCRIPTION
X	X	D3391-015	AFT TUBE ASSEMBLY
		D3391-025	AFT TUBE ASSEMBLY
1	1	D6014-090	AFT TUBE
1	1	D2646	AFT CAP
1	1	D3537-1	WEARPAD
1	1	D3537-7	WEARPAD
1	1	D3553-1	GASKET
1	1	D3553-3	GASKET
14	4	D3670-4200	SPACER
2	2	D3672-1	WASHER
14	14	AELS-1032-130	INSERT
12	12	AELS-1032-225	INSERT
4	4	ALS4-428-165	INSERT
6	6	AN3C4A	BOLT
4	4	AN3C5A	BOLT
10	10	AN960C10L	WASHER

C'BORE HOLES MARKED CB1-CB4 AS FOLLOWS AND
INSTALL AELS-1032-XXX AFTER FINISH AS NOTED

HOLES MARKED	QTY D3391-015	QTY D3391-025	C'BORE	P/N
CB1	12	12	Ø0.430 X 0.170	AELS-1032-225
CB2	4	4	Ø0.430 X 0.170	AELS-1032-130
CB3	6	6	Ø0.430 X 0.040	AELS-1032-130
CB4	4	4	NONE	AELS-1032-130

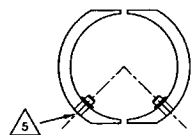


SECTION U-U
(SCALE 1:3)

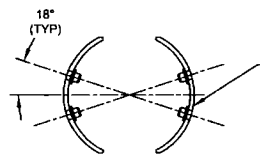

SECTION CC-CC
(SCALE 1:3)

DRILL Ø0.391
C'BORE Ø0.516 X 0.040 DEEP
INSTALL ALS4-428-165 INSERT (1)
(4 PLACES)

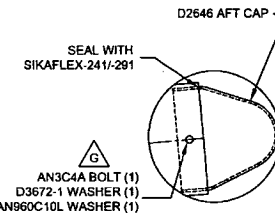

DETAIL T
(SCALE 1:3)

RELEASED
07-11-06

DESIGN	PH	DART AEROSPACE USA, INC
DRAWN	DC	PORT HADLOCK, WA
CHECKED	JS	DRAWING NO. D3391
MFG. APPR.	JS	REV. G
APPROVED	JS	SHEET 8 OF 8
DE APPR.	JS	TITLE 412 FLOAT SKIDTUBE
DATE	07.07.31	SCALE 1:12

COPYRIGHT © 2005 BY DART AEROSPACE USA, INC
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS
NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT
WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

NO. 77835
WORK ORDER
WITHOUT NOTICE
SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT

